PAGE: 1

PRINT DATE: 12/28/95

FAILURE MODES EFFECTS ANALYSIS (FMEA) - NON-CIL HARDWARE

NUMBER: M5-6MR-8016-X

SUBSYSTEM NAME: ORBITER DOCKING SYSTEM

REVISION:

OCT, 1996

PART NAME

PART NUMBER

VENDOR NAME

VENDOR NUMBER

LRU

ENERGIA POWER PANEL

MC621-0087-0009

RSC-E

CKB>-468-312-001

SRU

PUSH BUTTON SWITCH

PKZ-4 (AGO:360:212:TU)

PART DATA

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

PUSH-BUTTON SWITCHES (TWO DOUBLE POLE SWITCHES UNDER A SINGLE COVER CAP,) TWO POLE, MOMENTARY - APDS "PASSIVE HOOKS FIRING" COMMAND.

REFERENCE DESIGNATORS: 36V73A8A3SB6-83

36V73A8A3SB6-B4

QUANTITY OF LIKE ITEMS: 2

(DWT)

FUNCTION:

PROVIDES THE "PASSIVE HOOKS FIRING" COMMAND STIMULI TO CLOSE THE APPROPRIATE RELAY COILS IN THE PYROTECHNIC FIRE CONTROL UNIT (PFCU).

REFERENCE DOCUMENTS:

- 1) ECN 104-25012A. ODS ELECTRICAL CHANGE NOTICE.
- 2) CKB>=468312=001 _ J*P. SCHEMATIC DIAGRAM -

ANDROGYNOUS PERIPHERAL DOCKING SYSTEM (APDS)

CONTROL PANEL PU-APSS SCHEMATIC.

3) 33Y.5212.005."3. APDS CONTROL UNIT ELECTRICAL

SCHEMATIC.

4) VS70-953104, ODS INTEGRATED SCHEMATIC.

5) 17RC+10>260(F_J *P. PYRO FIRING CONTROL UNIT

ELECTRICAL

PAGE: 4 FRINT DATE: 12/28/95

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- NON-CIL FAILURE MODE

NUMBER: M5-6MR-B016-02

0

REVISION#

OCT, 1995

SUBSYSTEM NAME: ORBITER DOCKING SYSTEM

LRU: MC621-0087-0009

ITEM NAME: PUSH BUTTON SWITCH

CRITICALITY OF THIS

FAILURE MODE: 1R3

FAILURE MODE:

FAILS CLOSED (MULTIPLE CONTACTS WITHIN ONE SWITCH,) SHORTS TO GROUND

MISSION PHASE:

00

ON-ORBIT

VEHICLE/PAYLOAD/KIT EFFECTIVITY: 104 ATLANTIS

CAUSE:

A) PIECE PART FAILURE, B) CONTAMINATION, C) VIBRATION, D) MECHANICAL SHOCK, E) PROCESSING ANOMALY, F) THERMAL STRESS

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

CRITICALITY 1R2 DURING INTACT ABORT ONLY (AVIONICS ONLY)? NO

REDUNDANCY SCREEN

A) PASS

B) N/A

C) PASS

PASS/FAIL RATIONALE:

A)

6

FUNCTIONAL CRITICALITY 1R (FC., R FAULT TOLERANT OR GREATER) WITH AT LEAST TWO REMAINING OPERATIONAL . TATUS VERIFIED IN FLIGHT.

CI

METHOD OF FAULT DETECTION:

NONE.

MASTER MEAS. LIST NUMBERS:

V53X0765E

V53X0766E

CORRECTING ACTION:

NONE.

REMARKS/RECOMMENDATIONS:

CURRENT ORBITER BASELINE INVOLVES USING ACTIVE HOOKS ONLY ON THE ORBITER HALF OF THE ODS. HOWEVER, IN OFF-NOMINAL SITUATIONS, THE MIR ACTIVE HOOKS WOULD BE UTILIZED TO COMPLETE THE INTERFACE.

ORIGINAL

FAILURE MODES EFFECTS ANALYSIS (FMEA) — NON-CIL FAILURE MODE NUMBER: M5-6MR-8016- 02

- FAILURÉ EFFECTS -

(A) SUBSYSTEM:

LOSS OF SWITCH CONTROL CAPABILITY FOR THE PECU "PASSIVE HOOKS FIRING" CIRCUITS.

(B) INTERFACING SUBSYSTEM(S):

UNWANTED "PASSIVE HOOKS FIRING" COMMAND TO THE PECU.

(C) MISSION:

NO EFFECT.

(D) CREW, VEHICLE, AND ELEMENT(S):

FIRST FAILURE - NO EFFECT.

(E) FUNCTIONAL CRITICALITY EFFECTS:

POSSIBLE LOSS OF CREW OR VEHICLE AFTER FIVE FAILURES. 1) A GANG OF SIX HOOKS ON THE ORBITER SIDE FAILS TO CLOSE REQUIRING USE OF THE MIR SIDE HOOKS TO COMPLETE THE INTERFACE. 2) ONE OF TWO ASSOCIATED SWITCHES FAILS CLOSED. POTENTIAL "ACTIVE HOOKS FIRING" COMMAND TO THE PFCU. 3) ONE RPC FAILS ON (40 AMPS - ANY OF FOUR BUSES) RESULTING IN POWER BEING PROVIDED TO THE PFCU. 4) INTERNAL PFCU SWITCHING DEVICE INADVERTENTLY TRANSFERS AND PROVIDES POWER TO THE PYRO INITIATION BUSES. 5) PYRO LOGIC BUS "B" CIRCUIT BREAKER FAILS CLOSED RESULTING IN AN INADVERTENT PYRO FIRING. POSSIBLE VEHICLE SEPARATION OR LOSS OF HABITABLE VOLUME DUE TO UNWANTED "PYRO FIRE" COMMAND.

DESIGN CRITICALITY (PRIOR TO OPERATIONAL DOWNGRADE, DESCRIBED IN F): N/A

(F) RATIONALE FOR CRITICALITY CATEGORY DOWNGRADE:

N/A

- TIME FRAME -

TIME FROM FAILURE TO CRITICAL EFFECT: DAYS

TIME FROM FAILURE OCCURRENCE TO DETECTION: HOURS

TIME FROM DETECTION TO COMPLETED CORRECTIVE ACTION: N/A

TIME REQUIRED TO IMPLEMENT CORRECTIVE ACTION LESS THAN TIME TO EFFECT? N/A RATIONALE FOR TIME TO CORRECTING ACTION VS TIME TO EFFECT: N/A

HAZARDS REPORT NUMBER(S): ORBI 511

HAZARD DESCRIPTION:

LOSS OF PRESSURE IN HABITABLE VOLUME.

- APPROVALS -

PRODUCT ASSURANCE ENGR

: M. NIKOLAYEVA

DESIGN ENGINEER : B. VAKULIN

ORIGINAL